

Ref:CIVILAID:spl:4/1314 (o) Test Order dated: 17.04.2013

Date: 30.04.2013

M/s. United Office Systems Pvt. Ltd.,

Plot No. -62/1, 2 & 3, Vill-Vankas,

Taluka-Umbergoan, Dist. Valsad - 396150, Gujarat, India

Attn.: Sri. Shabbir Rajkotwala

## TEST REPORT ON ACCESS FLOORING SYSTEM

Source of sample

:

Sample supplied by the customer E mail letter dated 22.03.2013

Customer's Reference Date of test

Tests Conducted

15.04.2013

a. Concentrated Load Test till top deflection of 2.54mm, 3.00mm & 4.00 mm

Sample Identification\* Product Model No.\*

Steel Cementitious Panels low flange width "UNITILE USF LFW 30 0800 (Bare)"

Product code No.\*

"UNITILE USF 6400 0800 B 000 00 00000"

Panel size (Nominal) Thickness / Gross weight of Panel

600 mm x 600 mm 30 mm/12.800 kg.

CISCA 2003-2004 -

Test Method

RECOMMENDED TEST PROCEDURE FOR ACCESS FLOOR.

## **TEST RESULTS**

## Concentrated Load Test at various Deflections

Sample reference	UNITILE USF LFW 30 0800 (Corner Lock)  150 mm to 600 mm			
Finished floor height				
Location of indenter	Center	Edge	Corner**	
Deflection in mm at pre-load of 22.7kg	0			
Deflection in mm at load of 360 kg	1.85	1.96	1.98	
Residual deflection in mm at pre-load	0.05	0.07	0.05	
Location of indenter	Center Edge Center		dge Center	
Maximum Load at 2.54mm Deflection	390 kg	8.	411 kg	
Maximum Load at 3.00mm Deflection	418 kg		425 kg	
Maximum Load at 4.00mm Deflection	520 kg	:	518 kg	

## Note:

The panel is supported with 4 steel block jigs. 1.

A new bare panel is used for each test. (Center, Edge, Corner \*\*) \*\* Weakest point is located at about 220mm x 220mm from the corners.

contd...../-

Civil-Aid Technoclinic Pvt. Ltd. 1030, 13th Cross Banashankari 2nd Stage

Bangalore - 560 070. India

Tel.: +91 80 39950500, 26716831

Fax: +91 80 26716833

ctccivilaidinfo.in@in.bureauveritas.com

Sr. Technical Officer

www.civilaid.com

(Off/Lab) Tel.: +91 44 24847345 Chennai Hvderabad (Off) Tel.: +91 40 66824582

(Lab) Tel.: +91 40 64584582 Hyderabad Mangalore (Off/Lab) Tel.: +91 824 2213571



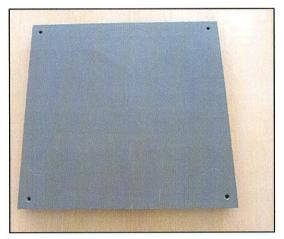




PHOTO 1: Images of UNITILE USF LFW 30 0800 (Corner Lock) before Testing

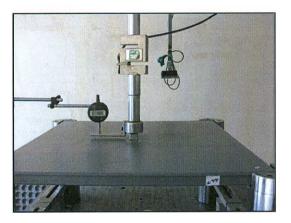


PHOTO 2: Images of UNITILE USF LFW 30 0800 (Corner Lock) while Testing

- \* As furnished by the customer
- Note: 1. The results relate only to the items tested.
  - 2.Report shall not be reproduced, except in full without the written approval of the lab. 3.Any correction invalidates this report.

for CIVIL AID TECHNOCLINIC PVT. LTD.

RADHA KRISHNA Sr. Technical Officer